

PROVIDING A TOTAL SOLUTION FOR HIGH STANDARD SAFETY CIRCUIT PROTECTION

Alpha Therm GmbH: Ihr Offizieller Vertriebskanal für SETsafe/SETfuse

Die Alpha Therm GmbH mit Sitz in Plankstadt, Deutschland, ist stolz darauf, der offizielle Vertriebskanal für SETsafe/SETfuse in Deutschland, Europa und weltweit zu sein. Unsere langjährige Partnerschaft mit SETsafe/SETfuse basiert auf einem erfolgreichen und vertrauensvollen Geschäftsmodell.

Wir repräsentieren SETsafe/SETfuse auf internationalen Messen wie der Electronica, InterSolar, ees und vielen weiteren. Von kleinen Standardsicherungen bis hin zu komplexen, kundenspezifischen Automotive-Projekten – wir haben alles erfolgreich umgesetzt. Mit unserer umfassenden Lagerhaltung in Deutschland gewährleisten wir schnelle und zuverlässige Lieferungen.

Kontaktieren Sie uns! Unser kompetentes Team berät Sie ausführlich und findet die optimale Lösung für Ihre Anforderungen. Vertrauen Sie auf Alpha Therm GmbH und SETsafe/SETfuse – Ihre Partner für innovative Sicherheitslösungen.

Kontakt:

- Tel.:
- [+49] 6202 / 575688 0
- E-Mail: <u>sales@alpha-therm.de</u>

Alpha Therm GmbH: Your Official Distribution Channel for SETsafe/SETfuse

Alpha Therm GmbH, based in Plankstadt, Germany, is proud to be the official distribution channel for SETsafe/SETfuse in Germany, Europe, and worldwide. Our long-standing partnership with SETsafe/SETfuse is built on a successful and trustworthy business model.

We represent SETsafe/SETfuse at international trade fairs such as Electronica, InterSolar, ees, and many more. From small standard fuses to complex, customized automotive projects, we have successfully handled it all. With our extensive warehousing in Germany, we ensure fast and reliable deliveries.

Contact us today! Our competent team will provide you with detailed advice and find the optimal solution for your requirements. Trust Alpha Therm GmbH and SETsafe/SETfuse – your partners for innovative safety solutions.

Alpha Therm GmbH Gewerbering 7 68723 Plankstadt Germany

Tel: +49 (0) 6202 / 575688 - 0 Fax: -10 E-Mail: sales@alpha-therm.de Web: www.alpha-therm.com



PD Series



Description

Thermal-Link (ATCO)-Alloy Type is defined as a non-resettable protective device functioning one time only. It is widely used in electrical equipment. ATCO is mainly consist of fusible alloy, flux resin, case, sealant and lead wires. Normally, fusible alloy is jointed to the two lead wires. Under abnormal conditions, when the temp. reaches to the fusing temp. of ATCO, the fusible alloy melts and guickly retracts to the two lead wire ends with the aid of the flux resin and disconnects the circuit completely.

SETsafe | SETfuse Thermal-Link (ATCO)-Alloy Type PD series Rated Functioning Temp. from 102 °C to 150 °C, Rated Current: 20 A, complies with RoHS and REACH.

Applications

- Surge Protective Devices
- Switched-Mode Power Supplies
- Batteries

Customization

- Other Temp.
- The Length of Lead Wires
- Leads Forming Types

Structure Diagrams

High Accuracy of Functioning

RoHS & REACH Compliant


Radial

Features

Temp.


Non-Resettable

High Surge Capacity

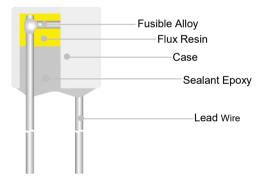


Marking

Radial (Color for reference only)

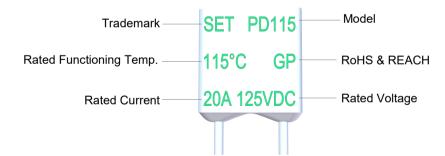

Remark: The Date Code means Year and quarter: A stands for 2000, B stands for 2001 and 01 stands for the first quarter, 02 stands for the second quarter, and so on.

Dimensions (mm) ≥

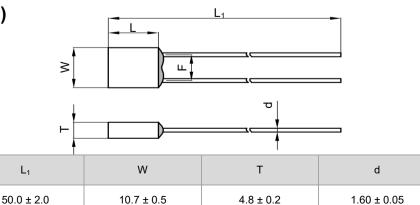

L

 11.8 ± 0.5

F

 6.6 ± 0.8



PD Series

Specifications

| (<i>T</i> _f) °C | | Model | Fusing Temp. | 7 _h | 7 _m | ار (A) | U _r | RoHS REACH |
|------------------------------|-----|-------|--------------|----------------|----------------|-----------|----------------|---------------|
| | 150 | PD150 | 145 ± 2 | 117 | 160 | 20 | DC 125 | • |
| Functioning Temp. | 136 | PD136 | 131 ± 2 | 102 | 160 | 20 | DC 125 | • |
| tioni | 130 | PD130 | 125 ± 2 | 97 | 160 | 20 | DC 125 | • |
| | 125 | PD125 | 121 ± 2 | 90 | 160 | 20 | DC 125 | • |
| Rated | 115 | PD115 | 111 ± 2 | 82 | 160 | 20 | DC 125 | • |
| Ř | 102 | PD102 | 98 ± 2 | 66 | 160 | 20 | DC 125 | • |

Note:

1: "●"Means certificated, "○"Means non-certificated.

2: RoHS & REACH Compliant .

PD Series

SET safe SET fuse

Soldering

Hand-Soldering

- 1. Soldering should be carried out according to Table T-1.
- 2. The thermal element of ATCO is fusible alloy with low melting point, which is jointed with ATCO lead wires. Improper soldering operation (too high soldering temp., too long soldering time, too short lead wire etc.) may transfer more heat to the thermal element and ATCO may open in advance.
- 3. When soldering conditions are more severe than those listed in Table T-1, a heat sink fixture should be used between soldering point and ATCO body.
- 4. When soldering, please do not pull / push or twist ATCO body or lead wires.
- 5. After soldering, let it naturally cool for longer than 20 seconds. During cooling, never move the ATCO body or lead wires.

TABLE T-1 Hand-Soldering Time

| Rated Functioning Temp. | | Max. Allow | able Sol | dering Tir | ne for Differe | nt Lead V | Vire Lengt | h (Fig.T-1) | | Max. Soldering Temp. |
|-------------------------------|----------------|--------------------------|------------|----------------|--------------------------|------------|----------------|--------------------------|-----|----------------------------|
| (<i>T</i> _f) | L _s | Time |) | L _s | Time |) | L _s | Tim | е | |
| | Length - | Tinned Copper Wire | CP Wire | Length | Tinned Copper Wire | CP Wire | Length | Tinned Copper Wire | | - |
| (°C) | (mm) | (s) | (s) | (mm) | (s) | (s) | (mm) | (s) | (s) | (°C) |
| 102 to 115 | 10 | 1 ^a | 4 | 20 | 2 | 5 | 30 | 3 | 6 | |
| 116 to 135 | 10 | 1ª | 4 | 20 | 3 | 6 | 30 | 5 | 8 | 400 |
| 136 to 150 | 10 | 3 | 6 | 20 | 5 | 8 | 30 | 5 | 8 | |

Note:

a: Auxiliary Heat Sink Fixture is Required to Avoid ATCO Cutting off Unexpectedly.

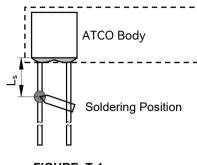


FIGURE T-1


SET safe SET fuse

Wave Soldering

The wave soldering parameters as Table T-2, for reference only, when ATCO is for practice use, you need to do some validation experiments. For example, using X-RAY to see the fusible alloy of ATCO whether damage after wave soldering.

TABLE T-2 Wave Soldering Parameters Setting

| Rated Functioning Temp. | Who | - | | ng Temp. re is Different | Preheating Time (t ₁) | Max. Wave Soldering | Dwelling Time (t ₂) | Cooling Time (t ₃) |
|-------------------------------|--------------------------|---------------------|--------------------------|-----------------------------|---|---------------------------|---------------------------------------|--------------------------------------|
| (<i>T</i> _f) | L _s Length | Preheating Temp. | L _s Length | Preheating Temp. | | Temp. | | |
| (°C) | (mm) | (°C) | (mm) | (°C) | (s) | (°C) | (s) | (s) |
| 102 to 130 | | | | Recommend | Hand-Soldering | | | |
| 131 to 150 | 20 | 80 | 30 | 90 | < 60 | ≤ 260 | ≤ 3 | ≤ 10 |

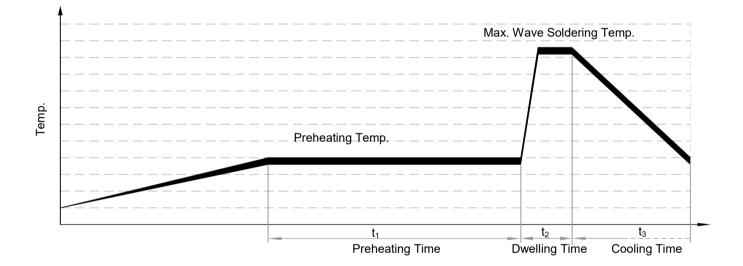


SET safe | SET fuse

PD Series

Thermal-Link (ATCO)-Alloy Type


Product Temp.-Time Curve (Reference)

The Temp.-Time Curve of Thermal-Link in different temp. oil bath.

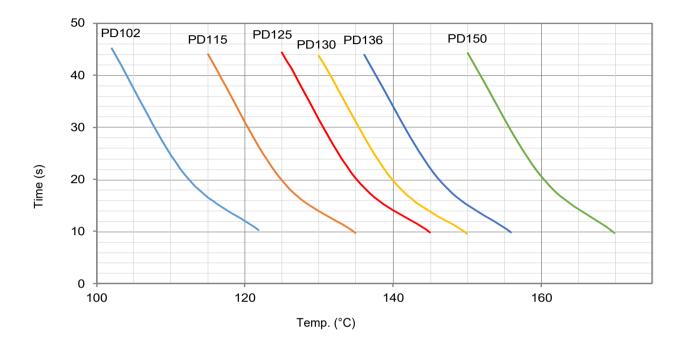

Product Current-Time Curve (Reference)

The Current-Time Curve shows functioning time at multi-times rated current at room temperature 25 ± 2 °C.

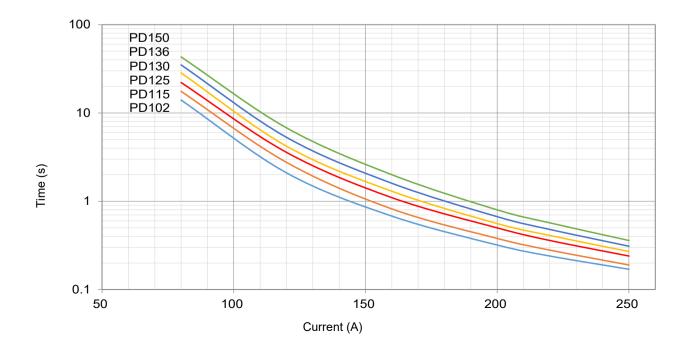




PD Series

Packaging Information

Bulk

| Item | PE Bag | PE Bag | Carton |
|-------------------|----------|-----------|-----------------|
| Dimensions (mm) | 135 × 85 | 190 × 180 | 440 × 300 × 260 |
| Quantity (PCS) | 30 | 180 | 9000 |
| Gross Weight (kg) | | · | 23.0 ± 10% |

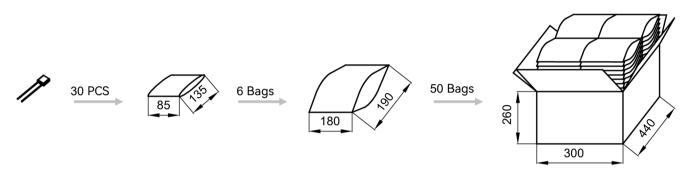




SET safe SET fuse

PD Series

Part Numbering System

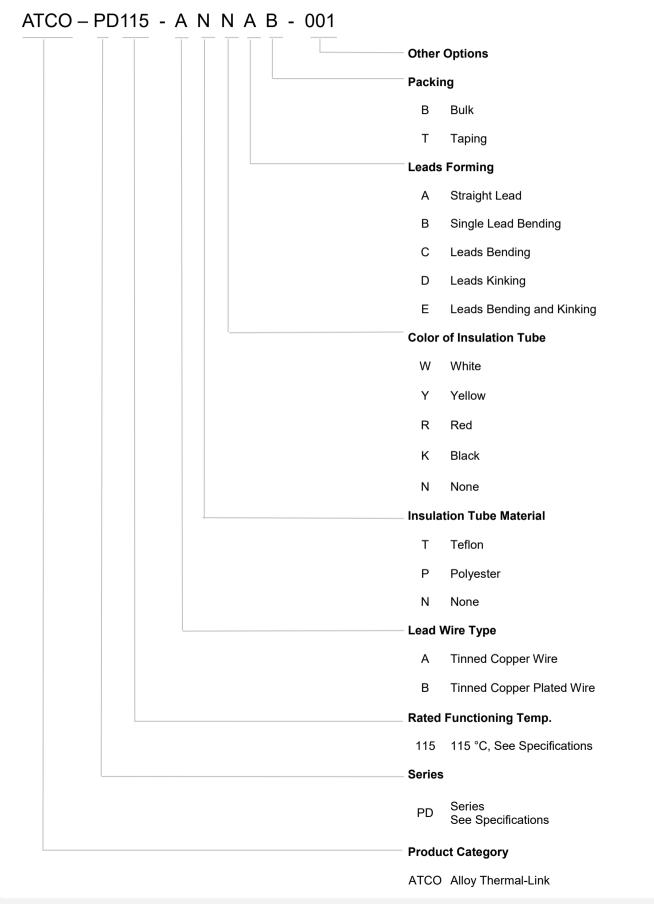



PD Series

Glossary

| Item | Description |
|------------------|---|
| тсо | Thermal-Link A non-resettable device incorporating a THERMAL ELEMENT which will open a circuit once only when exposed for a sufficient length of time to a temperature in excess of that for which it has been designed. — (GB 9816.1) |
| АТСО | Alloy Thermal-Link Alloy Type Thermal-Link, Alloy is the thermal element. — (GB 9816.1) |
| T _f | Rated Functioning Temp. The temperature of the Alloy Thermal-Link which causes it to change the state of conductivity with a detection current up to 10 mA as the only load. |
| | — (GB 9816.1) Tolerance: <i>T</i> _f °C (GB 9816.1, EN 60691, K60691). Tolerance: <i>T</i> _f ± 7 °C (J60691). |
| Fusing Temp. | Fusing Temp. The temperature of the Alloy Thermal-Link which causes it to change its state of conductivity is measured with silicone oil bath in which the temperature is increased at the rate of 0.5 °C to 1 °C / minute, with a detection current up to 10 mA as the only load. — (GB 9816.1) |
| T _n | Holding Temp. The Maximum temperature at which a Alloy Thermal-Link will not change its state of conductivity when conducting rated current for 168 hours. — (GB 9816.1) |
| T _m | Maximum Temp. Limit The temperature of the Alloy Thermal-Link stated by the manufacturer, up to which the mechanical and electrical properties of the Alloy Thermal-Link having changed its state of conductivity, will not be impaired for a given time. — (GB 9816.1) |
| l, | Rated Current The current used to classify a Alloy Thermal-Link, which is the Maximum current that Alloy Thermal-Link allows to carry and is able to cut off the circuit safely. — (GB 9816.1) |
| U, | Rated Voltage The voltage used to classify a Alloy Thermal-Link, which is the Maximum voltage that Alloy Thermal-Link allows to carry and is able to cut off the circuit safely. — (GB 9816.1) |
| J _n | Nominal Discharge Current Being able to withstand 15 peak currents of waveform 8/20 µs to test the product's durability of withstanding pulse current. — (UL 1449) |
| I _{max} | Max. Discharge Current Being able to withstand 1 peak current of waveform 8/20 μs to test max. pulse current that the product can withstand. — (UL 1449) |

SET safe | SET fuse

PD Series



ATTENTION

Usage

- 1. When atmosphere pressure is from 80 kPa to 106 kPa, the related altitude shall be from 2000 meters to 500 meters.
- 2. Operating voltage less than rated voltage of ATCO, operating current less than rated current of ATCO.
- 3. Do not touch the ATCO body or lead wires directly when power is on, to avoid burn or electric shock.

Replace

ATCO is a non-repairable product. For safety sake, it shall be replaced by an equivalent ATCO from the same manufacturer, and mounted in the same way.

Storage

Do not store the ATCO at the high temp., high humidity or corrosive gas environment, avoid influencing the solder-ability of the lead wires, the product shall be used up within 1 year after receiving the goods.

Installation

Make Sure the Temp. of Installation Position.

- 1. It is recommended that a dummy ATCO with inbuilt thermo-couple shall be used to determine the proper temp.
- 2. The terminal product should be tested to ensure that potential abnormal conditions do not cause ambient temp. to exceed the T_m of the ATCO.
- 3. Mount the ATCO at the location where temp. rises evenly.

Installation position of mechanical performance requirements.

- 1. Do not locate the ATCO in a place where severe vibration always occurs.
- 2. Ensure that the lead wire is long enough, and avoid actions such as press, tensile or twist.
- 3. The seal or body of ATCO must not be damaged, burned or over heated.



PD Series

Mechanical Connection

Riveting

- 1. Choose small resistivity riveting material and be riveted.
- 2. A flexible lead or lead with low resistance should be used to rivet the ATCO.
- 3. Contact resistance should be minimal, large contact resistance will lead to higher temp., ATCO Functioning in advance.

Crimping

- 1. Choose small resistivity crimping material and be crimped.
- 2. A flexible lead or lead with low resistance should be used to rivet the ATCO.
- 3. Contact resistance should be minimal, large contact resistance will lead to higher Temp., ATCO Functioning in advance.

Lead Wire Forming

- 1. If lead wire has to be bent, please pay attention to the distance between body and bending point. Refer to Table T-3.
- 2. When bending leads, please use pincher or similar tools to fix the product as shown in Fig.T-2, to avoid damaging the product.
- 3. During forming and mounting, lead wire should not be cut, nicked, bent sharply, to avoid breaking the product.
- 4. Tangential forces on the leads must be avoided (i.e. pushing or pulling on the leads at angle to ATCO body) as such forces may damage the seal of ATCO.

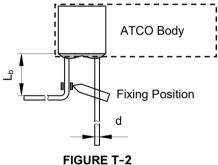


TABLE T-3 Distance between Body and Bending Point

| | d | (mm) | < 1.0 | 1.0 - 1.2 | > 1.2 |
|---------------|----------------|------|-------|-----------|-------|
| Circular lead | L _b | (mm) | ≥ 3 | ≥5 | ≥ 10 |




PD Series

Leads Forming Types

The below leads forming is for reference, more leads forming can be customized.

Radial

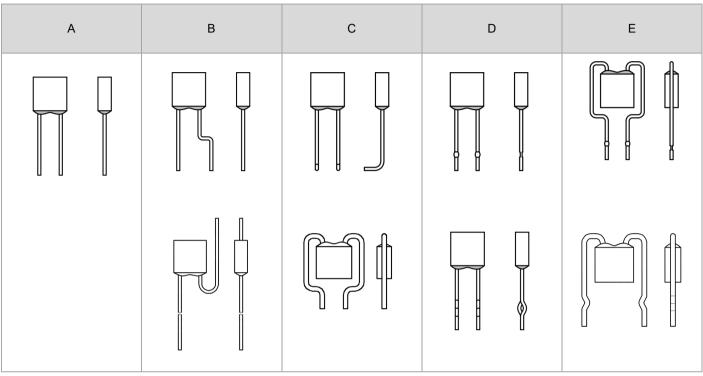

| | 230 221 | ः V31 | о Н31 | о В31 | о С31 | ୦ U31 | R31 | 0 | о К31 | X31 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | KG31 | о ХG31 | ି SK221 | SKL230 | SE230 | о ТК221 | |
|---|------------|----------|----------|----------|----------|----------|-----|-----|----------|-----|-----|------|----------|------|------|------|------|------|-----------|------------|--------|-------|------------|---------------|
| | 205 | V32 | H32 | B32 | C32 | U32 | R32 | 0 | K32 | X32 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | KG32 | XG32 | SK205 | 0 | 0 | TK205 | |
| | 200 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | SKL200 | SE200 | 0 | |
| C | 187 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | K17 | X17 | Y17 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| • (| 160 | V16 | H16 | B16 | C16 | U16 | R16 | F16 | K16 | X16 | Y16 | 0 | 0 | 0 | 0 | 0 | 0 | KG16 | XG16 | SK160 | 0 | 0 | TK160 | |
| J. | 150 | V7 | H7 | B7 | C7 | U7 | R7 | F7 | K7 | X7 | Y7 | S150 | T150 | 0 | 0 | N150 | G150 | KG7 | XG7 | SK150 | 0 | SE150 | TK150 | |
|). (| 145 | V6 | H6 | B6 | C6 | U6 | R6 | F6 | K6 | X6 | Y6 | | | 0 | | 0 | 0 | KG6 | XG6 | SK145 | | SE145 | TK145 | |
| Ĕ | 139 | V13 | H13 | B13 | C13 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| Це | 136 | V9 | H9 | B9 | C9 | 0 | 0 | 0 | K9 | X9 | Y9 | S136 | T136 | P136 | Q136 | N136 | G136 | KG9 | XG9 | 0 | | 0 | 0 | |
| Rated Functioning Temp. (<i>T</i> ,) °C | 135 | V5 | H5 | B5 | C5 | U5 | R5 | 0 | K5 | X5 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | KG5 | XG5 | SK135 | 0 | SE135 | TK135 | Model |
| nir | 133 | V8 | H8 | B8 | C8 | 0 | 0 | F8 | K8 | X8 | Y8 | 0 | 0 | 0 | 0 | 0 | 0 | KG8 | XG8 | 0 | | 0 | 0 | bde |
| 0 | 130 | V4 | H4 | B4 | C4 | U4 | R4 | F4 | K4 | X4 | Y4 | 0 | 0 | 0 | 0 | N130 | G130 | KG4 | XG4 | SK130 | 0 | 0 | TK130 | <u>.</u> |
| ct | 125 | V3 | H3 | B3 | C3 | U3 | R3 | F3 | K3 | X3 | Y3 | S125 | T125 | 0 | 0 | N125 | G125 | KG3 | XG3 | SK125 | 0 | SE125 | TK125 | |
| .in | 123 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| 5 | 120 | 0 | 0 | 0 | 0 | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| tec | 115 | V2 | H2 | B2 | C2 | U2 | R2 | F2 | K2 | X2 | Y2 | S115 | T115 | P115 | Q115 | N115 | G115 | KG2 | XG2 | SK115 | 0 | SE115 | TK115 | |
| Ra | 105 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | 0 | 0 | 0 | |
| _ | 102 | V1 | H1 | B1 | C1 | U1 | R1 | F1 | K1 | X1 | Y1 | S102 | T102 | 0 | 0 | N102 | G102 | KG1 | XG1 | SK102 | 0 | SE102 | TK102 | |
| | 97 | V21 | H21 | B21 | C21 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| | 95 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| | 86 | V18 | H18 | B18 | C18 | U18 | R18 | F18 | K18 | X18 | Y18 | 0 | 0 | 0 | 0 | 0 | 0 | KG18 | XG18 | 0 | 0 | 0 | 0 | |
| | 76 |) V0 | H0 | B0 | C0 | U0 | R0 | F0 | K0 | X0 | Y0 | 0 | 0 | 0 | 0 | 0 | 0 | KG0 | XG0 | 0 | 0 | 0 | 0 | \rightarrow |
| r () Rated C | | 1 | 2 | 3 | 5 | 10 | 15 | 1 | 2 | 3 | 5 | 10 | 15 16 | 20 | 25 | 30 | 40 | 2 | 3 | 10 | 10 | 10 | 15 16 | |
| U _r (V Rated V | AC) | | | | | | | | | | | | | 250 | | | | | | | | | | |
| | | | | | | | | | | | | | | | | | | | Ţ | | | | | |

Radial Shape

Thermal-Link (ATCO)-Alloy Type Feature & Model List Overview

Axial Shape

SET safe SET fuse
PD Series

Radial Shape (Screw Hole)

Thermal-Link (ATCO)-Alloy Type

| | | | | | | | | | | | | | | | | | | | | | | / | |
|-----------------------------|---------------|-------|--------|-----|-----|----|-----|-------|----------|------|-----|-----|------|------|-------|----------------------|-------|-------------------|----------------|---------------------------------------|--------|----------------------|---------------|
| | 230 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| | 221 | 0 | 0 | | 0 | 0 | 0 | 0 | 0 | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | | 0 | 0 | 0 | 0 | |
| | 205 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| | 200 | 0 | 0 | 0 | 0 | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| 0 | 187 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| ů | 160 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| Ľ. | 150 | 0 | 0 | KM7 | XM7 | Y7 | YM7 | SM150 | TM150 | 0 | KM7 | XM7 | 0 | 0 | HU7 | HR7 | 0 | 0 | HC7 | 0 | HL7 | HW7 | |
| <u> </u> | 145 | SY145 | TY145 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | HU6 | HR6 | HS145 | HP145 | HC6 | HN145 | HL6 | HW6 | |
| du | 139 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| Tel | 136 | 0 | 0 | 0 | 0 | Y9 | YM9 | SM136 | TM136 | Q136 | 0 | 0 | P136 | Q136 | 0 | 0 | HS136 | HP136 | 0 | HN136 | 0 | 0 | |
| D | 135 | 0 | 0 | KM5 | XM5 | 0 | 0 | 0 | 0 | 0 | KM5 | XM5 | 0 | 0 | HU5 | HR5 | 0 | 0 | HC5 | 0 | HL5 | HW5 | Model |
| j. | 133 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | bd |
| 0 | 130 | SY130 | TY130 | KM4 | XM4 | Y4 | YM4 | 0 | 0 | 0 | KM4 | XM4 | 0 | 0 | HU4 | HR4 | 0 | 0 | | 0 | HL4 | HW4 | 0 |
| Functioning Temp. (T_i) | 125 | | TY125 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | KM3 | XM3 | P125 | Q125 | HU3 | HR3 | | HP125 | HC3 | HN125 | HL3 | HW3 | |
| | 123 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| 5 | 120 | - | TY120 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| Rated | 115 | SY115 | TY115 | 0 | 0 | 0 | 0 | SM115 | | Q115 | 0 | 0 | P115 | Q115 | HU2 | HR2 | 0 | 0 | HC2 | 0 | HL2 | HW2 | |
| Ra | 105 | SY105 | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| | 102 | 0 | 0 | 0 | 0 | 0 | 0 | SM102 | | 0 | 0 | 0 | P102 | Q102 | HU1 | HR1 | 0 | 0 | HC1 | 0 | HL1 | HW1 | |
| | 97 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| | 95 | SY95 | TY95 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| | 86 | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | HU18 | HR18 | 0 | 0 | HC18 | 0 | HL18 | HW18 | |
| | 76 | | 0 | 0 | 0 | 0 | 0 | 0 | | 0 | | | | | HU0 | HR0 | | | HC0 | | HL0 | HW0 | \rightarrow |
| r (Rated C | A) Current | 10 | 15 | 2 | 3 | 5 | 5 | 10 | 15 16 | 25 | 2 | 3 | 20 | 25 | 10 | 15 | 5 | 10 | 5 | 15 | 10 | 15 | |
| Ur (N Rated N | | 2 | 50 | | | | 300 | | | | 32 | 20 | 40 | 00 | | 50 | 00 | | 6 | 90 | 8 | 00 | |
| Proc Struc | | Cylin | drical | | | | | Ę | Ú Ú | pe | | | | | Axial |]]] Shape | | Shape ectrode) | Axial Shape | Axial Shape (Flat Electrode) | Axial |]] J Shape | |

Thermal-Link (ATCO)-Alloy Type Feature & Model List Overview

_ _

SET safe SET fuse

Thermal-Link (ATCO)-Alloy Type

| | | | | | | | | | | | | | | | | | | | | | / | N |
|--------------|---|--|--|---|---|---|---|---|--|--|---|--|---|---|---|---|---|---|--|--|--|--|
| 230 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| | 0 | 0 | 0 | 0 | 0 | | | 0 | | 0 | 0 | 0 | | 0 | 0 | 0 | 0 | 0 | | R31 | 0 | |
| 205 | 0 | 0 | 0 | 0 | 0 | V32 | | 0 | B32 | 0 | 0 | 0 | C32 | 0 | 0 | 0 | 0 | 0 | U32 | R32 | 0 | |
| 200 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| 187 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| 160 | 0 | 0 | 0 | 0 | 0 | V16 | H16 | 0 | B16 | 0 | 0 | 0 | C16 | 0 | 0 | 0 | 0 | 0 | U16 | R16 | 0 | |
| 150 | V7 | H7 | B7 | 0 | C7 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | U7 | R7 | 0 | |
| 145 | V6 | H6 | B6 | 0 | C6 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | C6 | U6 | R6 | 0 | |
| 139 | V13 | H13 | B13 | 0 | C13 | 0 | 0 | 0 | 0 | 0 | SF13 | V13 | 0 | 0 | 0 | C13 | M13 | 0 | 0 | 0 | CR13 | |
| 136 | V9 | H9 | B9 | | C9 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| 135 | V5 | H5 | B5 | 0 | C5 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | U5 | R5 | 0 | Model |
| 133 | V8 | H8 | B8 | 0 | C8 | 0 | 0 | 0 | 0 | SF8 | 0 | V8 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | bo |
| 130 | V4 | H4 | B4 | 0 | C4 | 0 | 0 | 0 | 0 | SF4 | 0 | V4 | 0 | 0 | 0 | 0 | 0 | 0 | U4 | R4 | 0 | e |
| 125 | V3 | | B3 | 0 | C3 | 0 | H3 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | U3 | R3 | 0 | |
| 123 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| | | H2 | B2 | 0 | C2 | | | | | | 0 | | 0 | 0 | C2 | | 0 | 0 | U2 | R2 | 0 | |
| | | | | | | | | | | | | | | | | | | | | | | |
| | | | | | | | | | | | | | | | | | | | | | | |
| | | | | | | | | | | | | | | | | | | | | | | |
| | | | | | | | | | | | | | | | | | | | | | | |
| | | | | | | | | | | | | | | | | | | | | | | |
| | Í | | | | | | | | | | | | | | | | | | | | | \rightarrow |
| urrent | 1 | 2 | 3 | 5 | / | 1 | 2 | 2.5 | 3 | 3 | 5 | 4 | 5 | 6 | 8 | 8.5 | 9 | 10 | 10 | 15 | 15 | |
| DC) | | | 50 | | | | | | | | | | 6 | 0 | | | | | | | | |
| luct ture | | | | | | | | | | | | | | | | | | | | | | |
| | 200 187 160 150 145 139 136 135 133 130 125 123 120 115 105 102 97 95 86 76 A) urrent DC) oltage | 221 ○ 205 ○ 200 ○ 187 ○ 160 ○ 150 V7 145 V6 139 V13 136 V9 135 V5 133 V8 130 V4 125 V3 123 ○ 120 ×11 97 V21 95 ○ 86 V18 76 V0 A) 1 DC) □ | 221 ○ ○ 205 ○ ○ 200 ○ ○ 187 ○ ○ 160 ○ ○ 150 V7 H7 145 V6 H6 139 V13 H13 136 V9 H9 135 V5 H5 133 V8 H8 130 V4 H4 125 V3 ○ 120 ○ ○ 121 ○ ○ 122 ○ ○ 105 ○ ○ 102 V11 H1 97 V21 H21 95 ○ ○ 86 V18 H18 76 ○ □ A) 1 2 DC) □ □ | 221 0 0 0 205 0 0 0 200 0 0 0 187 0 0 0 160 0 0 0 150 V7 H7 B7 145 V6 H6 B6 139 V13 H13 B13 136 V9 H9 B9 135 V5 H5 B5 133 V8 H8 B8 130 V4 H4 B4 125 V3 B3 0 0 120 0 0 0 1 120 0 0 0 0 102 V1 H1 B1 97 97 V21 H21 B21 0 97 V21 H2 3 3 0 0 0 50 50 0 50 50 50 | 221 0 0 0 0 205 0 0 0 0 200 0 0 0 0 187 0 0 0 0 160 0 0 0 0 160 0 0 0 0 150 V7 H7 B7 0 145 V6 H6 B6 0 139 V13 H13 B13 0 136 V9 H9 B9 0 135 V5 H5 B5 0 133 V8 H8 B8 0 130 V4 H4 B4 0 123 0 0 0 0 120 0 0 0 0 105 V2 H2 B2 0 105 0 0 0 0 86 V18 H18 B18 C18 76 V0 H0 B0 C | 221 0 0 0 0 0 205 0 0 0 0 0 0 200 0 0 0 0 0 0 187 0 0 0 0 0 0 160 0 0 0 0 0 0 150 V7 H7 B7 0 C7 145 V6 H6 B6 0 C6 139 V13 H13 B13 0 C13 136 V9 H9 B9 0 C9 135 V5 H5 B5 0 C5 133 V8 H8 B8 0 C3 120 0 0 0 0 0 121 V2 H2 B2 0 C2 102 V1 H1 B1 C1 0 97 V21 H21 B21 C21 0 95 0 0 0 | 221 0 | 221 0 0 0 0 0 131 205 0 0 0 0 0 132 200 0 0 0 0 0 0 0 187 0 0 0 0 0 0 0 0 187 0 0 0 0 0 0 0 0 160 0 0 0 0 0 0 0 0 160 V7 H7 B7 0 C7 0 0 145 V6 H6 B6 0 C6 0 0 139 V13 H13 B13 0 C13 0 0 136 V9 H9 B9 0 C5 0 0 131 V13 H8 B8 0 C3 0 0 120 V3 B3 0 C3 0 0 0 102 V1 H1 B1 C1 | 221 0 0 0 0 0 V31 H31 0 205 0 0 0 0 0 0 0 0 0 200 0 0 0 0 0 0 0 0 0 187 0 0 0 0 0 0 0 0 160 0 0 0 0 0 0 0 0 160 0 0 0 0 0 0 0 0 160 V7 H7 B7 0 C7 0 0 0 145 V6 H6 B6 0 C6 0 0 0 136 V9 H9 B9 0 C9 0 0 0 133 V8 H8 B8 0 C8 0 0 0 120 V3 B3 0 C3 0 0 0 0 121 V2 H2 | 221 0 0 0 0 V31 H31 0 B31 205 0 0 0 0 0 V32 H32 0 B32 200 0 0 0 0 0 0 0 0 0 0 187 0 0 0 0 0 0 0 0 0 1860 0 0 0 0 0 0 0 0 0 160 V7 H7 B7 0 C7 0 0 0 0 138 V13 H13 B13 0 C13 0 0 0 0 136 V9 H9 B9 0 C5 0 0 0 0 0 133 V8 H8 B8 0 C4 0 | 221 0 0 0 0 V31 H31 0 B31 0 205 0 < | 221 0 0 0 0 V31 H31 0 B31 0 0 205 0 0 0 0 0 V32 H32 0 B32 0 0 200 0 <th>221 ○</th> <th>221 0 0 0 0 V31 H31 0 B31 0 0 0 C31 205 0 0 0 0 0 V32 H32 0 B32 0</th> <th>221 0 0 0 0 V31 H31 0 B31 0 0 0 0 C31 0 205 0</th> <th>221 0 0 0 0 V31 H31 0 B31 0 0 0 C31 0 0 205 0</th> <th>221 0 0 0 0 V31 H31 0 B31 0 0 C31 0 <th< th=""><th>221 0 0 0 0 V31 H31 0 B31 0 0 0 C31 0 0 0 0 200 0</th><th>221 0 0 0 0 0 1 1 0 B31 0 0 C31 0 0 0 0 205 0 <</th><th>221 0 0 0 0 0 0 1 131 0 B31 0 0 C31 0 <</th><th>221 0 0 0 0 V3 H31 0 B31 0 0 C31 0 <</th><th>221 0 0 0 0 0 1 11 0 B31 0 0 C31 0 <</th></th<></th> | 221 ○ | 221 0 0 0 0 V31 H31 0 B31 0 0 0 C31 205 0 0 0 0 0 V32 H32 0 B32 0 | 221 0 0 0 0 V31 H31 0 B31 0 0 0 0 C31 0 205 0 | 221 0 0 0 0 V31 H31 0 B31 0 0 0 C31 0 0 205 0 | 221 0 0 0 0 V31 H31 0 B31 0 0 C31 0 <th< th=""><th>221 0 0 0 0 V31 H31 0 B31 0 0 0 C31 0 0 0 0 200 0</th><th>221 0 0 0 0 0 1 1 0 B31 0 0 C31 0 0 0 0 205 0 <</th><th>221 0 0 0 0 0 0 1 131 0 B31 0 0 C31 0 <</th><th>221 0 0 0 0 V3 H31 0 B31 0 0 C31 0 <</th><th>221 0 0 0 0 0 1 11 0 B31 0 0 C31 0 <</th></th<> | 221 0 0 0 0 V31 H31 0 B31 0 0 0 C31 0 0 0 0 200 0 | 221 0 0 0 0 0 1 1 0 B31 0 0 C31 0 0 0 0 205 0 < | 221 0 0 0 0 0 0 1 131 0 B31 0 0 C31 0 < | 221 0 0 0 0 V3 H31 0 B31 0 0 C31 0 < | 221 0 0 0 0 0 1 11 0 B31 0 0 C31 0 < |

Thermal-Link (ATCO)-Alloy Type Feature & Model List Overview

PD Series

SET safe SET fuse

Thermal-Link (ATCO)-Alloy Type

| | | | | | | | | | | | | | | | | | | / | N |
|---|---------------|--------|------------------|-----|-----|-----|----|------|----------|-------|------|-------|----------|-------|-------|----------|-------------|-----------|---------------|
| | 230 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| | 221 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| | 205 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| | 200 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| | 187 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| ° | 160 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| ۔ ت | 150 | 0 | 0 | 0 | 0 | 0 | 0 | S150 | T150 | 0 | 0 | SD150 | TD150 | PD150 | QD150 | HS150 | HP150 | HN150 | |
| 0 | 145 | 0 | 0 | 0 | 0 | F6 | X6 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| du | 139 | 0 | 0 | 0 | 0 | F13 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| Ter | 136 | 0 | 0 | 0 | 0 | 0 | X9 | S136 | T136 | P136 | Q136 | SD136 | TD136 | PD136 | QD136 | HS136 | HP136 | HN136 | |
| ່ວ | 135 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | Model |
| ir | 133 | 0 | 0 | 0 | 0 | F8 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | bd |
| <u>io</u> | 130 | 0 | 0 | 0 | 0 | F4 | 0 | 0 | 0 | 0 | 0 | SD130 | TD130 | PD130 | QD130 | 0 | 0 | 0 | Ð |
| Rated Functioning Temp. (<i>T</i> ,) °C | 125 | KG3 | XG3 | K3 | X3 | 0 | 0 | S125 | T125 | P125 | Q125 | SD125 | TD125 | PD125 | QD125 | HS125 | HP125 | HN125 | |
| n. | 123 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| 5 | 120 | 0 | 0 | 0 | 0 | 0 | 0 | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| tec | 115 | KG2 | XG2 | K2 | X2 | F2 | 0 | S115 | T115 | P115 | Q115 | SD115 | TD115 | PD115 | QD115 | 0 | 0 | 0 | |
| Ra | 105 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| _ | 102 | KG1 | XG1 | K1 | X1 | F1 | 0 | S102 | T102 | P102 | Q102 | SD102 | TD102 | PD102 | QD102 | 0 | 0 | 0 | |
| | 97 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| | 95 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| | 86 | KG18 | XG18 | K18 | X18 | F18 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | |
| | 76 |) | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | \rightarrow |
| r (Rated C | urrent | 2 | 3 | 2 | 3 | 3 | 4 | 10 | 15 16 | 20 | 25 | 10 | 15 16 | 20 | 25 | 5 | 10 | 15 | |
| U _r (V Rated V | DC) oltage | | | 6 | 30 | | | 1 | 00 | | 120 | | 1: | 25 | | | 200 | | |
| Prod Struc | | Radial | Shape v Hole) | | | | | | Radial | Shape | | | | | | Axial Sh | ape (Flat E | lectrode) | |

Thermal-Link (ATCO)-Alloy Type Feature & Model List Overview

PD Series

SET safe SET fuse



